

HEADLIGHT BEZEL FASTENER INSTALLATION

TSB162

PREPARED BY: Bryan King

DATE: 28 May 2014

Models affected: Some 2014 200 Series vehicles

Description of problem: Some models of the American Sportworks TW200 vehicles (2014 model TW201) as shown in Fig (1) have been noted to have headlight bezels that did not fully adhere to the hood surface. In these cases, vehicles should be reworked to the instructions outlined below. Call ASW Customer Service with your vehicle PIN number to have your Replacement Parts shipped to you for this repair at 800-643-7332.

Solution: Installation of (4) blind rivets in the locations as shown.

Tools required:

- Drill
- (4) Blind Rivets (black) to be supplied by ASW (p/n 15937)
- 1/8" drill bit
- Pop Rivet Gun

Procedure:

1. Drill 1/8" holes in locations "A" and "B" as shown in Fig 2 for each headlight (4 holes total). Ensure that the drilled holes pass through both the hood and headlight bezel plastics.
2. Install (4) blind rivets from the exterior side of the hood, ensuring that the rivet clinches both sheets of plastic.



fig. 1



fig. 2

 **WARNING**
USE PROTECTIVE EYEWEAR - Always wear proper safety gear when using tools